Technical Service Bulletin

No.LA501-030V2
26
September 2006

Reissue **Please replace the previous edition of this bulletin.**

This bulletin supersedes TSB LA501-030/2006 dated 18 September, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

Subject/Concern:	Discovery 3/LR3 - Washer Reservoir Leak

Models:		
Discovery 3 / LR3		VIN- range: Up to 6A408013

Markets: All

Section: 501-16

Summary:

A customer may report a concern of a fluid leak from the front of the vehicle, possibly suspecting a coolant/radiator leak. Closer inspection may reveal the windscreen reservoir to be the cause of the leak.

This bulletin has been re-issued to correct the labor time.

Cause: A manufacturer process error has resulted in a weak seam joint at the base of the washer reservoir.

Action: Should a customer express concern regarding the above, refer to the Service Instruction detailed in this bulletin.

NOTE: If the new reservoir does not meet the inspection criteria detailed below, it should be scrapped and a scrap material on site credit request (ZCR180) raised, ensuring this bulletin reference number is included in the text.

Parts Required:

Description	Part Number	Quantity
Reservoir - windshield washer, with headlamp power wash	DMB500040	1
Reservoir - windshield washer, less headlamp wash/wipe	DMB500030	1

Labour Time:

Operation Description	Operation No.	Time
Reservoir - combined windscreen/headlamp washer - renew	84.10.03	1.50 hours

Repair/Claim Coding:

Causal Part:	DMB500040
ACES Condition Code:	01
Defect Code:	

rrservice.ru

Service Instruction

1 . Inspect the washer reservoir to confirm the leak is from the seam joint at the base of the washer reservoir.

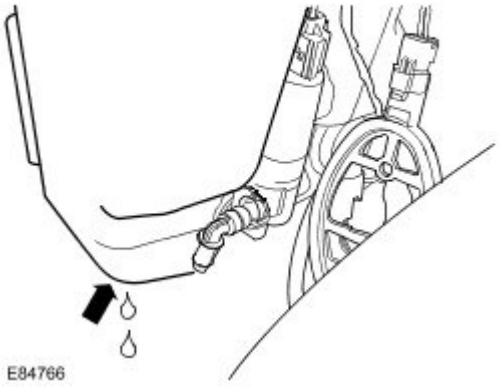

2 . **NOTE:** The new reservoir should be inspected prior to installation to ensure that a quality-controlled assembly is used. A quality-controlled assembly can be identified by the presence of a yellow paint pen mark on the side of the reservoir. If this is not present, check the date printed on a white label attached to the reservoir. The date of manufacture printed on the label must be after 25th July 2006.

Renew the windscreen washer reservoir. For additional information, refer to Global Technical Reference (GTR) Discovery 3/LR3 Workshop Manual Section 501-16, Reservoir - windshield washer, renew (84.10.03).

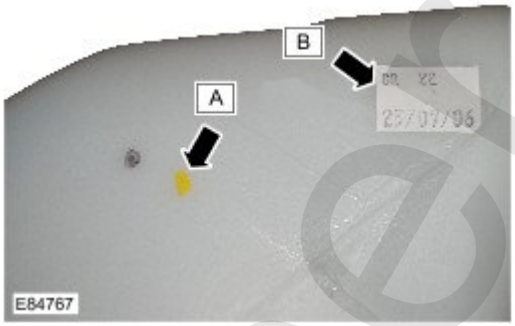

©2006 LandRover

LRservice.ru